

COUNTAXTM

SERVICE BULLETIN

04- T2-24



DATE: 17\06\04

MODELS CONCERNED: C Series with K55 Transmission


CONCERN: Cooling Fan Assembly change

The combined Pulley and Fan 40 5054 00 will no longer be supplied for this Transaxle. Instead a Plastic fan, separate pulley and washers will be supplied. These should be fitted as per the diagram below:

The gear change arm will also need to be removed and bent to match the drawing below. This is to ensure the gear change rod does not foul the fan.

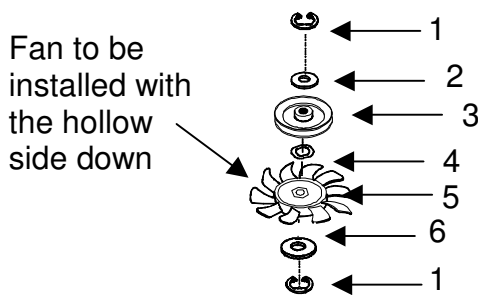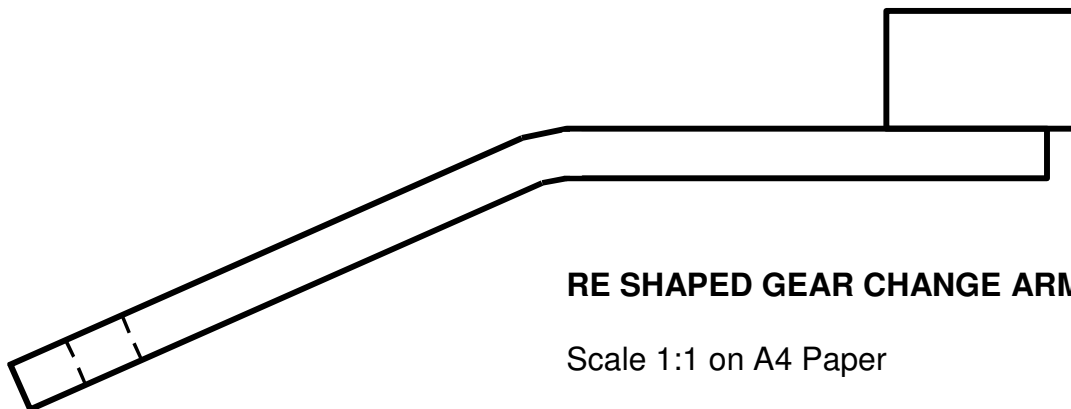

No	Description	Part No	No Off
1	14mm External Circlip	07 9066 00	Not In Kit
2	9/16" T4 Washer	08 9178 00	1
3	Plastic Fan	14 80070 00	1
4	Lock Washer	1A6460 83060	1
5	Pulley	20 08116 00	1
6	9/16" T4 HP Washer	08 9177 00	1

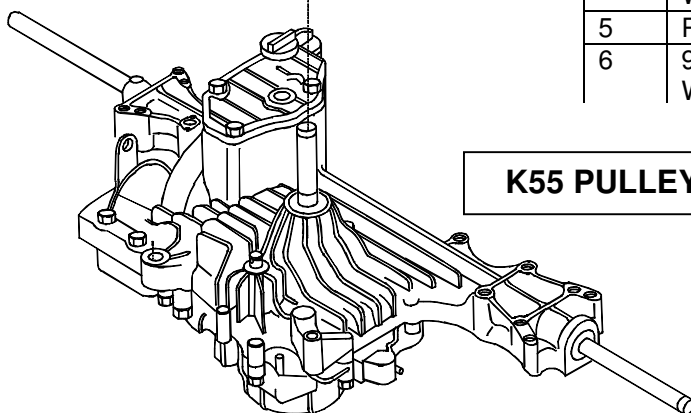

K55 PULLEY & FAN KIT

40 5054 01