COUNTAX

SERVICE BULLETIN

DATE: 03\07\2014

14-T3-27

MK3 Scarifier, 300 Litre PGC & Spreader
MK4 B Series B60-4TRAC, B250-4TRAC / C Series C50, C60, C80 / F Series F60-4TRAC, F250-4TRAC / T Series T50, T60 & T80.
Pre 2014 model accessories require an additional cable plug n order to function with MK4 tractors.

Cable Plug

This service bulletin is an update to **bulletin 14-08-34**. The kits explained in the previous document are valid for MK4 tractors built up until 16th June 2014. This announcement shows new kit requirements for tractors made from June 16th. This service announcement replaces **bulletin 14-T3-25**. The information laid out in the previous bulletin is now obsolete.

Problem


The 2014 MK4 tractor is designed with added safety features not found on earlier models. 2014 rear mounted, belt driven accessories will not function without a safety cut out switch that plugs into a rear tractor port. **Accessories made before 2014** lack the necessary cut out switch and will require a cable plug to function with the new tractor.

Model	Part Required	Part No.	Kit Part No.
Scarifier	Cable Plug	449882000	
	M8 x 20 Bolt	019483600	50100048
	M8 Nyloc Nut	049383700	
PGC (300 L)	Cable Plug	449882200	
	M5 x 16 Bolt	02912200	50100049
	M5 Nyloc Nut	04885900	
Spreader	Cable Plug	449882200	
	M5 x 16 Bolt	02912200	50100049
	M5 Nyloc Nut	04885900	




Fitting Instructions

- 1. Fit the loop end to the accessory (PGC / Scarifier / Spreader).
- 2. Secure the cable plug using the unused bolt hole and kit fixings (see diagrams below).
- 3. Link the plug to the tractor by connecting the plug end with the tractor socket mount (see diagram below).

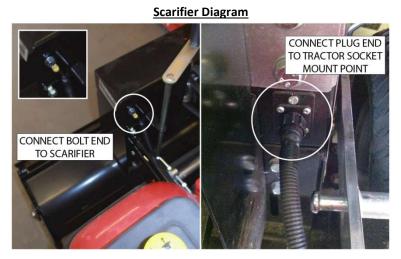

PGC Diagram

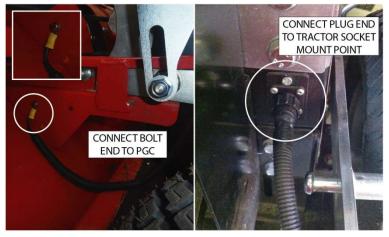

Spreader Diagram

